SAA09VE14-001

REV. E

B/L: 006.01 SYS: ORBITER

ACCESS ARM

NOV 1 2 1992

Critical Item:

LOWER HINGE ACTUATOR (2 Items Total)

Find Number:

A101364

Criticality Category:

15

SAA No:

09VE14-001

System/Area:

ORBITER ACCESS ARM /

LC-39 PAD A&B

NASA

PMN/

U70-0503

Part No: 75M12560

Name:

ORBITER ACCESS ARM

Mfa/

FLOTORK

Drawing/

79K06013, 79K40015

Part No:

NONE

Sheet No:

4

Function: Extends and retracts the Orbiter Access Arm. Lower actuator assembly (A101364) is redundant with Upper Actuator Assembly (A101349).

Critical Failure Mode/Failure Mode No: Fails to actuate / 09VE14-001.002

Fallure Cause: Seizes, severe leakage.

Failure Effect: Arm cannot be extended or may exceed the 30 second maximum allowable time due to mechanical seizure or severe leakage. Possible loss of life.

ACCEPTANCE RATIONALE

Design:

- Four (4) piston actuators coupled to the hinge post weldment act in a redundant manner.
- Seal design (square cross-section) minimizes tendency to roll and .035" piston land clearance reduces possibility of seal causing selzure.
- · Combination of bronze liner and steel piston extremely reliable with respect to seizure.

Test:

• Emergency Extend and Retract test is performed prior to each launch, File VI OMRSD requirement.

Inspection:

Actuator inspected for external leakage annually per OMI V6C50.

Failure History:

 The PRACA database was researched and no failure data was found on this component in the critical failure mode.

SAA09VE14-001 REV. É

NOV 1 2 1992

• The GIDEP failure data interchange system was researched and no failure data was found on this component in the critical failure mode.

Operational Use:

• Correcting Action:

There is no action which can be taken to mitigate the failure effect.

• Timeframe:

Since no correcting action is available, timeframe does not apply.